

CODE: CC-278

DATE: APRIL 27, 1994

SUBJECT: POSSIBLE TRANSMISSION CLUTCH ROD MISLOCATED ON 2000 SERIES TRACTORS. (MODELS 2130-2185)

Transmission adjustable clutch rod may have been inadvertently mislocated on the above tractors. Should this occur you will experience improper operation of the transmission. It will be slow and unresponsive in forward or reverse and lacks power. (Transmission torque).

Should you experience either situation, as mentioned above, the following should be done.

Look at the attached parts diagrams and determine which diagram applies to your specific tractor. Install the clutch rod (item no. 3) and its respective parts, into the proper hole location at each end of the clutch rod. (FRONT ROD INSTALL IN CLUTCH CAM ASSEMBLY item no.2 REAR ROD INSTALL IN GEAR SHIFT BRACKET item no. 1)

Adjustment should be made to the rod as follows:

NOTE: ALL ADJUSTMENTS SHOULD BE MADE AT THE FRONT ROD FERRULE

- 1) Depress the brake pedal and lock into place.
- 2) Adjust the ferrule until the rod can be installed at the back of the slot. (Towards the rear of tractor)
- 3) Check for proper operation of the tractor.

The tractor should now perform as designed.

Circulate and initial

Service Mgr.	Parts Mgr.	Service Tech.	Service Tech.	
--------------	------------	---------------	---------------	--

