

PROFESSIONAL SERIES (PRO Z -S)

Date: March 09, 2023

Part Numbers Affected: 680-00536 Front Yoke Assembly
680-00536-4021 Front Yoke Assembly

PRO Z S 500 Model Affected: PRO Z 500 KW 554-S (53TIHJUN050).
PRO Z 500 KW 560-S (53TIHJUV050).

PRO Z S 700 Model Affected: PRO Z 700 KW 760-S (53TIHKUV050).

PRO Z S 900 Models Affected: PRO Z 900 KW 960-S (53TIHMUV050).
PRO Z 900 EFI 960-S Sure Path (53RIHMAV050).
PRO Z 900 KW 972-S (53FIHMUY050).
PRO Z 900 KW 972-S Sure Path (53RIHMAY050).
PRO Z 900 KW 972-SD (53TIHMUY050).

Serial Number Range Affected: Above Listed Models Built November 01, 2017 to October 19, 2022.
1K017Hxxxxx through 1J19NH70019

Subject: 30mm Front Yoke Replacement Service Kit

FIX-AS-FAIL

NOTE: These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.

NOTE: Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.

NOTE: Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction.

PURPOSE:

We have made an improvement for the Front Yoke Assembly used on the above listed Affected Models Manufactured from November 01, 2017 through October 19, 2022. This improved Front Yoke Assembly consist of a larger spindle shaft of 30mm from the previous 25mm spindle shaft.

This Advisory will provide the steps for the procedure for replacement to install the improved Front Yoke Assembly with a larger 30mm spindle shaft.

ACTION REQUIRED:

If a customer has a failure of a Front Yoke Assembly, please follow the steps listed for the repair of both Front Yoke Assemblies, left and right side. We strongly recommend the replacement of both Front Yoke Assemblies to prevent additional down time of the rider.

1. Order quantity two (2) of Service Kit **759-05919** from your normal parts source. **NOTE: The Service Kit 759-05919 contains the parts needed for the replacement of only one Front Yoke Assembly.**

759-05919 Service Kit Contents

ITEM NO.	PART NUMBER	QTY	DESCRIPTION
1	680-01434A	1	30mm YOKE ASSEMBLY
2	712-04338A	2	3/4-16 HEXFLNG NUT
3	736-05033A	1	WAVE WASHER
4	741-05950	1	LOWER BRG.
5	741-0941A	1	UPPER BRG.

Instruction sheet included with kit.

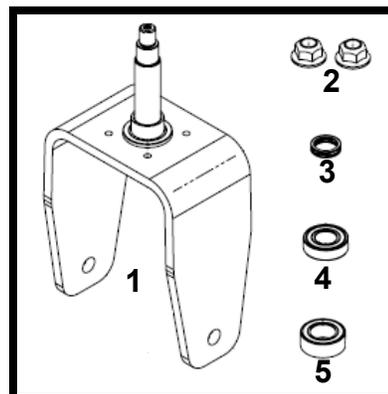


FIGURE 1

