

CODE: CC-293


DATE: DECEMBER 21, 1994

SUBJECT: SERIES 2000 SNOWTHROWERS MODEL 190-303

**PROBLEM:** WE HAVE RECEIVED SOME REPORTS FROM THE FIELD OF THE 303 SNOWTHROWERS WHEN IN THE RAISED POSITION, THE LIFT LATCH ROD IS NOT ENGAGED COMPLETELY INTO THE LIFT HANDLE LATCH BRACKET(#703-2728), ALLOWING THE SNOWTHROWER TO BECOME DISENGAGED AND DROP TO THE GROUND.

**SOLUTION:** REMOVE THE LIFT HANDLE LATCH BRACKET AND GRIND OUT THE SHADED IN AREA SHOWN IN FIG. 1 BELOW. THIS WILL ALLOW THE LIFT LATCH ROD TO HAVE BETTER ENGAGEMENT.

FLAT RATE: .5 HOUR

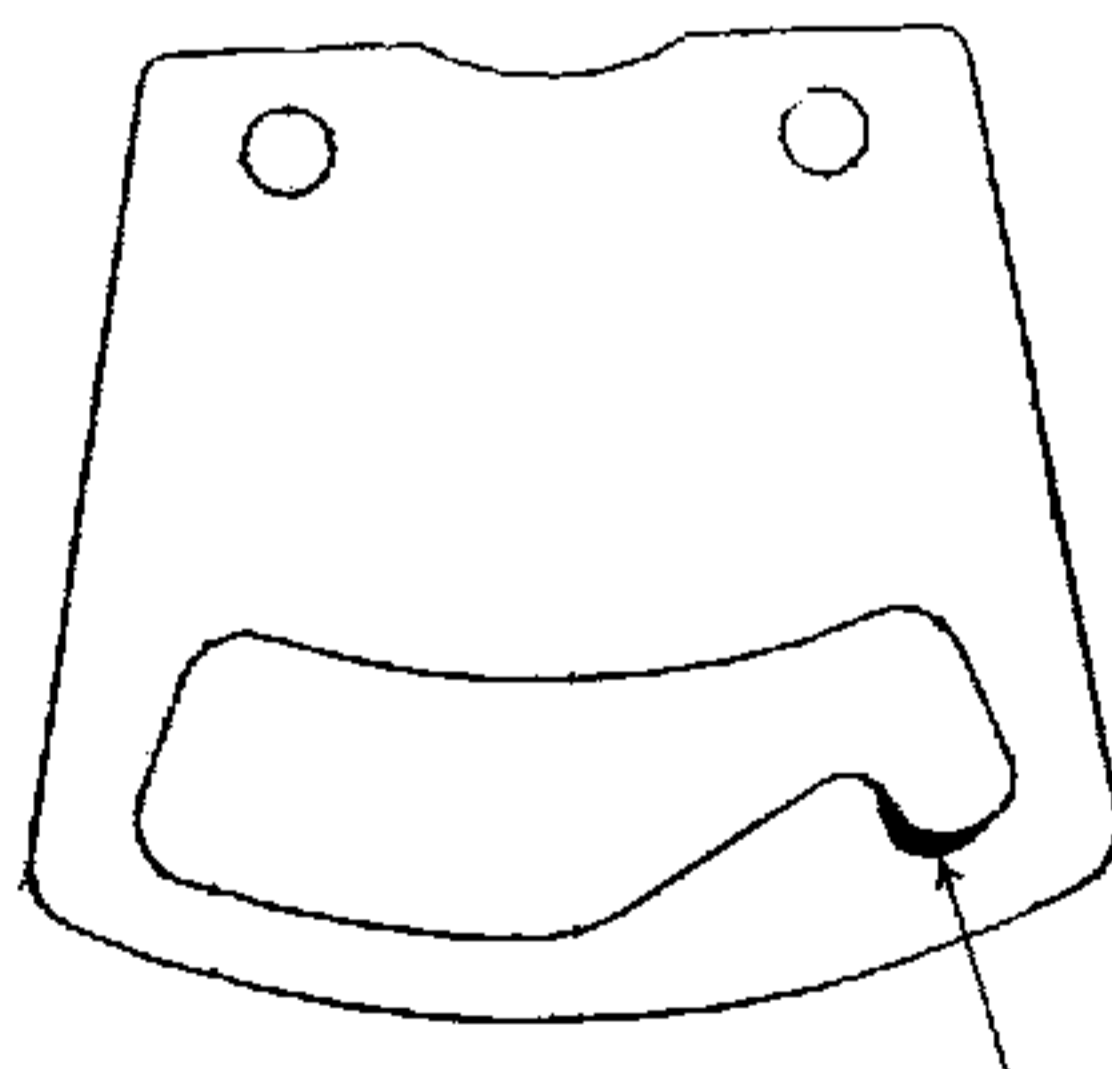

GRIND HERE

703-2728  
LIFT HANDLE LATCH BRACKET  
FIG. 1

Circulate and initial

Service Mgr.	Parts Mgr.	Service Tech.	Service Tech.	
--------------	------------	---------------	---------------	--