



Service Advisory

CC-551

SERIES 2000 & 2500

Models Affected: GT 2542 (14A-2D2G710). GT 2544 (14A-2C7L710).
GT 2550 (14A-2E7P710). GT 2554 (14A-2A7K710).

Serial Number Range Affected: All 2006 Production Units..

Date: **October 24, 2006.**

Subject: **Interference with the Front Mounted 190-302-100 42" Front Blade Attachment and the Hood Latch Rod 747-04423.**

IMPORTANT ATTENTION PARTS MANAGER ATTENTION SERVICE MANAGER

PURPOSE: To notify dealers of an interference installing the front mounted 190-302-100 42" Front Blade attachment on the above model tractors. When the left & right hitch plates are inserted into the tractor frame channels, they will come in contact with the front side of the hood latch rod and will not allow the retaining bolts to secure the attachment to the tractor.

SOLUTION: A change has been made to the hood latch rod. Remove and discard the existing hood latch rod 747-04423. Order part number **747-04423A** and install the new hood latch rod. Refer to the installation instruction in the Owner's Manual.

Please make a note of this information in your buisness system, sales sheets and parts manual.

Warranty: Normal warranty terms apply. Indicate Service Advisory CC-551 and 747-04423 as the original failed part on the claim. Repair time allowance is 0.2 Hrs.

| SERVICE MANAGER | PARTS MANAGER | SALES MANAGER | SERVICE TECH. | SERVICE TECH. |
|-----------------|---------------|---------------|---------------|---------------|
| | | | | |

Circulate and Initial