



Service Advisory

CC-661

LTX1000 SERIES

Models Affected: **LTX1040** (13WX90AS010). **LTX1042** (13AX91AS010, 13WX91AS010). **LTX1045** (13AX91AT009, 13AX91AT010, 13AX91AT056, 13AX91AT256, 13RX91AT056, 13RX91AT256, 13WX91AT010). **LTX1046** (13AP91AT010, 13WR91AT009, 13WR91AT010). **LTX1046 VT** (13VR91AT009, 13VR91AT010, 13VR91AT209, 13WP91AT010).

Serial Number Range Affected: 2009 Model Year LTX1000 with 46" ("T") Decks and early production 2010 Model Year LTX1000 with 42" ("S") and 46" ("T") Decks.

Date: **January 26, 2010**

Subject: **42" and 46" Decks' RH Idler Binding**

PURPOSE: Heavy debris build-up on the deck may cause the right hand idler bracket to bind resulting in degraded cutting performance.

PARTS REQUIRED: Qty. (1) = 736-0344 - Flat Washer: .385 I.D. x 1.0 O.D. x .030"

SOLUTION:

1. Place tractor on a flat level surface.
2. Turn off engine, remove ignition key and set parking brake ON.

3. Allow engine and muffler to cool before proceeding.
4. To facilitate access to the RH tensioning idler remove deck from under the tractor.
5. Install a spacer washer in accordance with Figure 1.

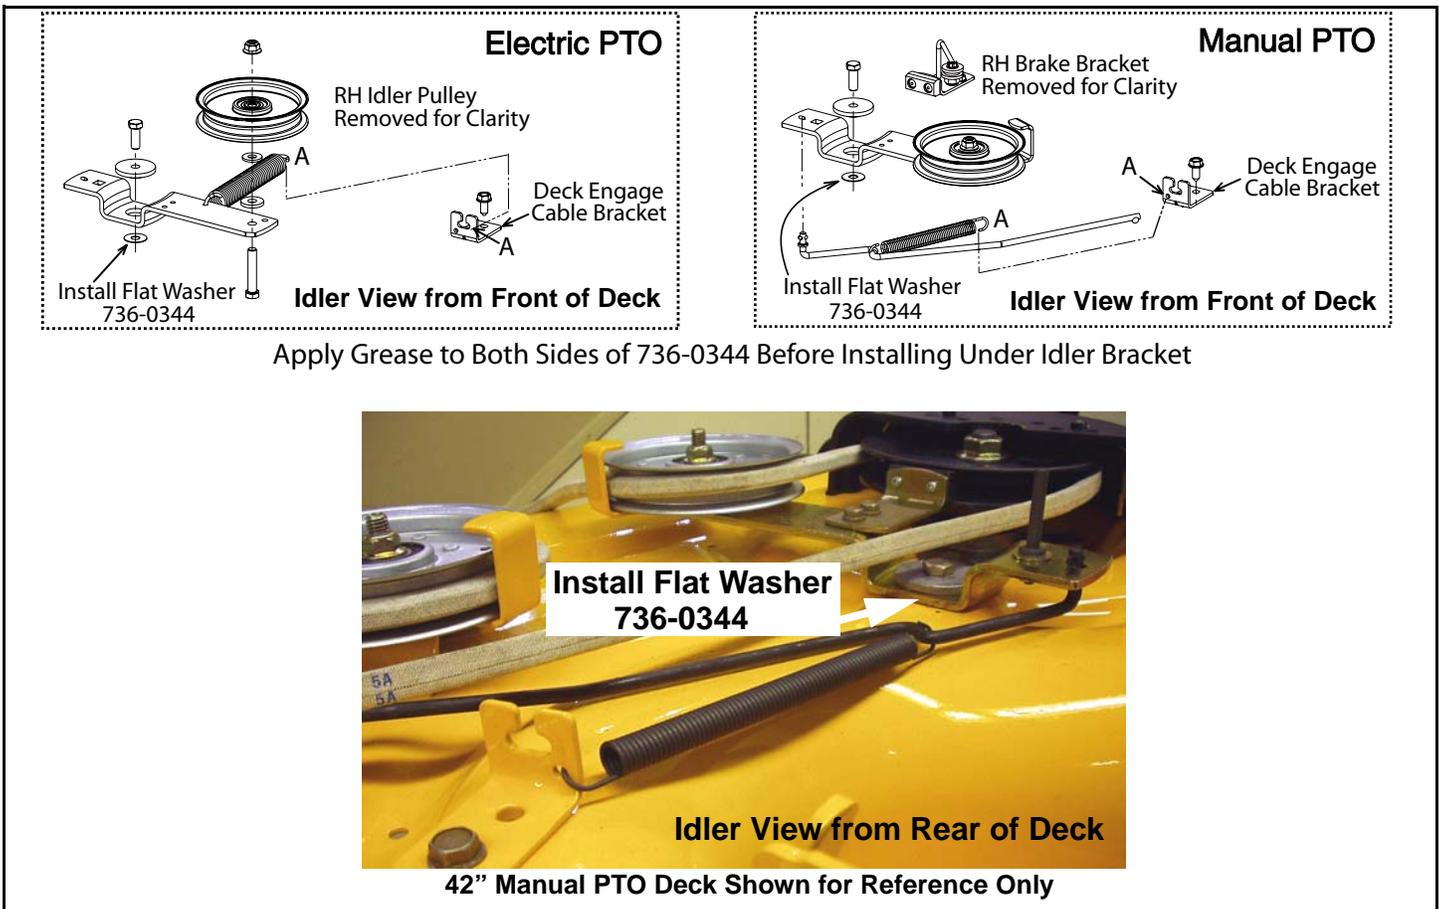


FIGURE 1

This Advisory is being released for informational purposes only.

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial