

XT1 & XT2 ENDURO SERIES

Date: June 07, 2022

Parts Affected: 683-05182, 683-05182A, 983-05182, 983-05182A RH Deck Brake Assy.
 732-05151, 732-05151A Torsion Spring.
 783-08863, 783-08863A, 783E08863A Idler Pivot Bracket.

Subject: 42" Manual P.T.O. Mower Deck Upgrades

INFORMATIONAL ONLY

NOTE: These materials are prepared for use by trained technicians who are experienced in the service and repair of equipment of the kind described in this publication, and are not intended for use by untrained or inexperienced individuals. Such individuals should seek the assistance of an authorized service technician or dealer.

NOTE: Always wear eye protection while servicing equipment. Wear hearing protection when appropriate. Always work in a well ventilated area and follow all safety precautions when dealing with combustible materials.

NOTE: Left (LH) and Right (RH) sides are determined from the operator's position and facing in the forward direction.

PURPOSE:

Upgrades have been integrated into the Manual P.T.O. Mower Decks for the RH Deck Brake Assembly, Idler Pivot Bracket and the LH Brake Assembly Torsion Spring. Models from 2015 through 2021 with the letter "A" in the fifth (5) position and a "S" in the eighth (8) position (13XXA~~XXX~~SXXX) of the Factory Model Number are affected in this upgrade.

ACTION REQUIRED:

If any one of the Parts Affected listed above needs replacing use the Service Kit 753-11336 42" Deck Brake Kit for upgrading the affected parts with the most recent upgrades.

753- 11336 Service Kit Contents

(See Figure 1)

ITEM NO.	PART NUMBER	QTY	DESCRIPTION
1	683-05182	1	RH Deck Brake Assy.
2	783-08863B	1	Idler Pivot Bracket
3	732-08321	1	Torsion Spring
4	710-06133	2	M6-1x 0.625" Hex Acorn Washer Screw
5	712-04063	1	5/16-18 Nylon Lock Flange Nut

Instruction sheet included with kit

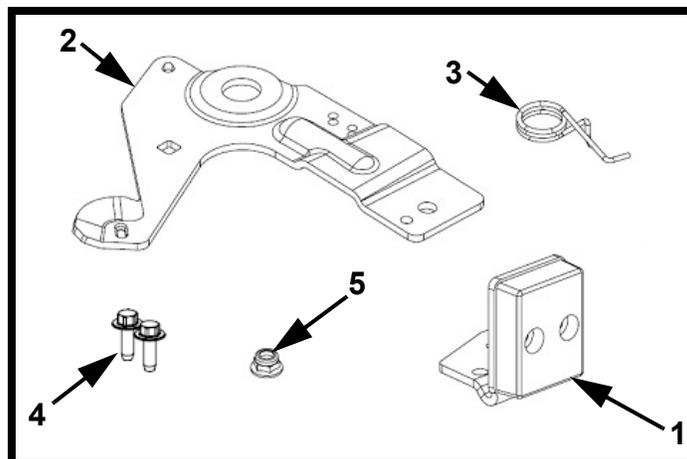


FIGURE 1

This Advisory is being released for informational purposes only.

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial

DRM