



Service Advisory

CC-537A

Series 2000/2500

Models Affected: GT 2542 (14A-2D2G710)
GT 2544 (14A-2C7L710)
GT 2550 (14A-2E7P710)
GT 2554 (14A-2A7K710)

Serial Number Range Affected: Above tractor models built prior to January 13, 2006. (Prior to **1A136G**).


Date: August 23, 2006 **Revised On November 10, 2008 (Destroy All Previous Copies).**

Subject: **759-04136A Hood Service Kit**


PURPOSE: When a hood is required and the unit is without a heat shield extension, order **759-04136A Hood Service Kit**. This service kit includes a hood plus an additional exhaust heat shield to help redirect heated exhaust air away from the lower portion of the hood and latch assembly area.

IMPORTANT ATTENTION PARTS MANAGER ATTENTION SERVICE MANAGER

NOTE: Decals & labels are NOT INCLUDED in the 759-04136A Hood Service Kit. All decals & labels for the hood must be ordered separately and the part numbers are shown on the reverse side of this advisory.

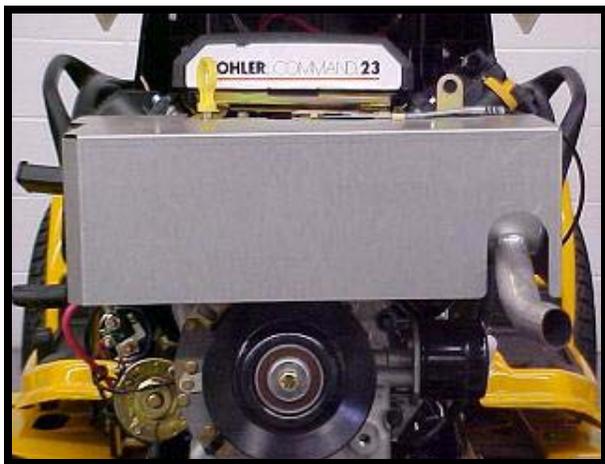

UNIT WITHOUT HEAT SHIELD EXTENSION

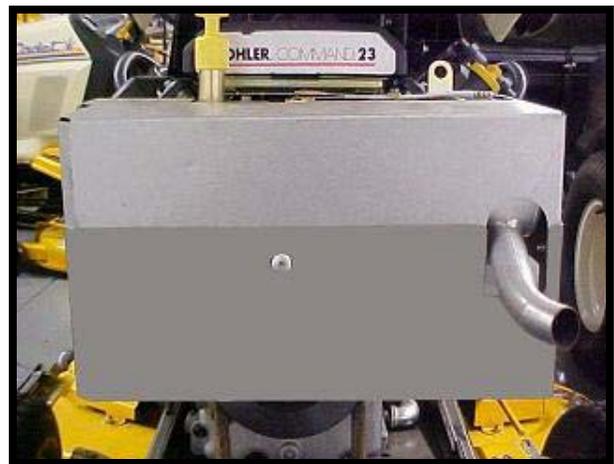

UNIT WITH HEAT SHIELD EXTENSION

Parts List for the 759-04136A listed on reverse side.

Service Kit Contents 759-04136A

| ITEM NO. | PART NUMBER | QTY | DESCRIPTION |
|----------|-------------|-----|----------------------------------|
| 1 | 703-05939 | 1 | Muffler Extension Shield |
| 2 | 726-0233 | 4 | Push Nut |
| 3 | 728-0177 | 3 | Pop Rivet 3/16 x .450" |
| 4 | 731-05161 | 1 | Hood Cover |
| 5 | 731-06887 | 1 | Hood |
| 6 | 736-0400 | 3 | Flat Washer .194" x .62" x .063" |
| 7 | 710-1242 | 4 | 5/16-14 x .75 HiLow Screw |

Instruction Sheet included with kit.

NOTE: The Hood Kit 759-04136A Does Not Include Labels. All Labels Need To Be Ordered Per Tractor Model. Below Is A List Of Labels Available. All Models Require The L.H & R.H. Hood Stripe (Cub Cadet) Labels. Order Model Designation Labels As Required.

List Of Labels

| MODEL NO. | PART NUMBER | QTY | DESCRIPTION |
|-----------|-------------|-----|------------------------------|
| ALL | 777D09722 | 1 | L.H. Hood Stripe (Cub Cadet) |
| ALL | 777D09721 | 1 | R.H. Hood Stripe (Cub Cadet) |
| GT 2542 | 777D09713 | A/R | L.H. GT 2542 Label |
| GT 2542 | 777D09714 | A/R | R.H. GT 2542 Label |
| GT 2544 | 777D09716 | A/R | L.H. GT 2544 Label |
| GT 2544 | 777D09715 | A/R | R.H. GT 2544 Label |
| GT 2550 | 777D09717 | A/R | L.H. GT 2550 Label |
| GT 2550 | 777D09718 | A/R | R.H. GT 2550 Label |
| GT 2554 | 777D09720 | A/R | L.H. GT 2554 Label |
| GT 2554 | 777D09719 | A/R | R.H. GT 2554 Label |

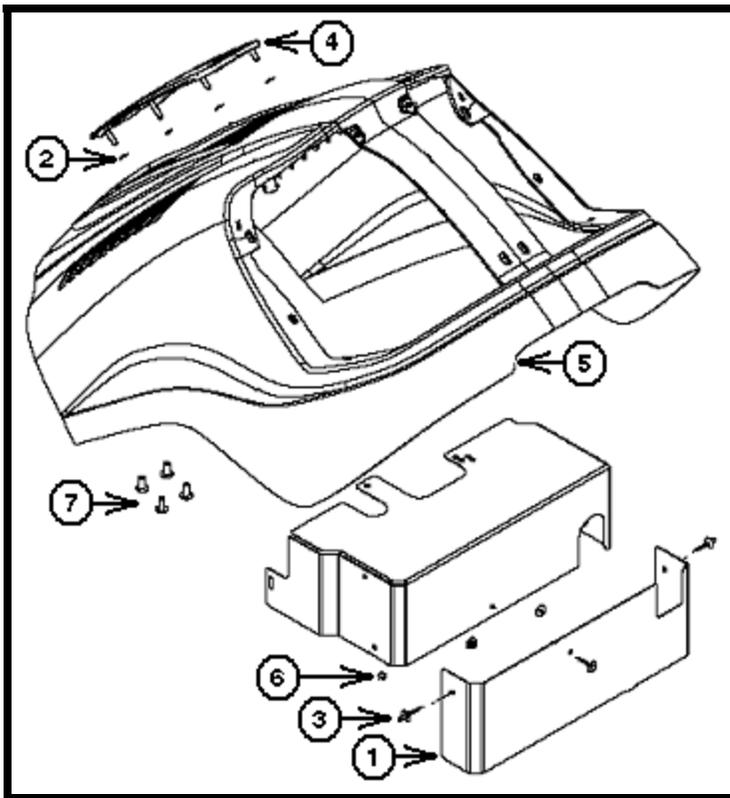


FIGURE 1

Warranty: Normal warranty terms apply. Indicate Service Advisory **CC-537A** and **703-05875** as the original failed part on the claim. Repair time allowance is 1.0 Hrs.

| SERVICE MANAGER | PARTS MANAGER | SALES MANAGER | SERVICE TECH. | SERVICE TECH. |
|-----------------|---------------|---------------|---------------|---------------|
| | | | | |

Circulate and Initial