



Service Advisory CC-355

LAWN TRACTOR AND SERIES 2000

Model: 2185

Date: November 10, 1997

Subject: MECHANICAL FUEL PUMP

A mechanical fuel pump for the above model tractor is now available. Beginning at engine serial number 2625400007, the model 2185 series tractors will have the new pump as standard equipment.

The new fuel pump is built into the #2 (oil filter side) valve cover and is activated by the intake rocker arm. Although the valve covers were originally designed to be interchangeable, the mechanical pump can only be used on the #2 side; the same side as the original pulse pump.

A fuel pump retrofit kit (part number KH-24-559-02) has been developed for converting engines with the original pulse pump, but the latest Style "B" (see Figure 1) rocker arms are required. Engines above serial number 2520800007, or those that have KH-24-755-66 valve train kit installed (refer to Service Bulletin CC-341), will have the Style "B" rocker arms and can accept the new kit. Engines that have Style "A" rocker arms (see Figure 1) must be changed to the Style "B" by installing KH-24-755-66 kit before the mechanical pump kit can be installed.

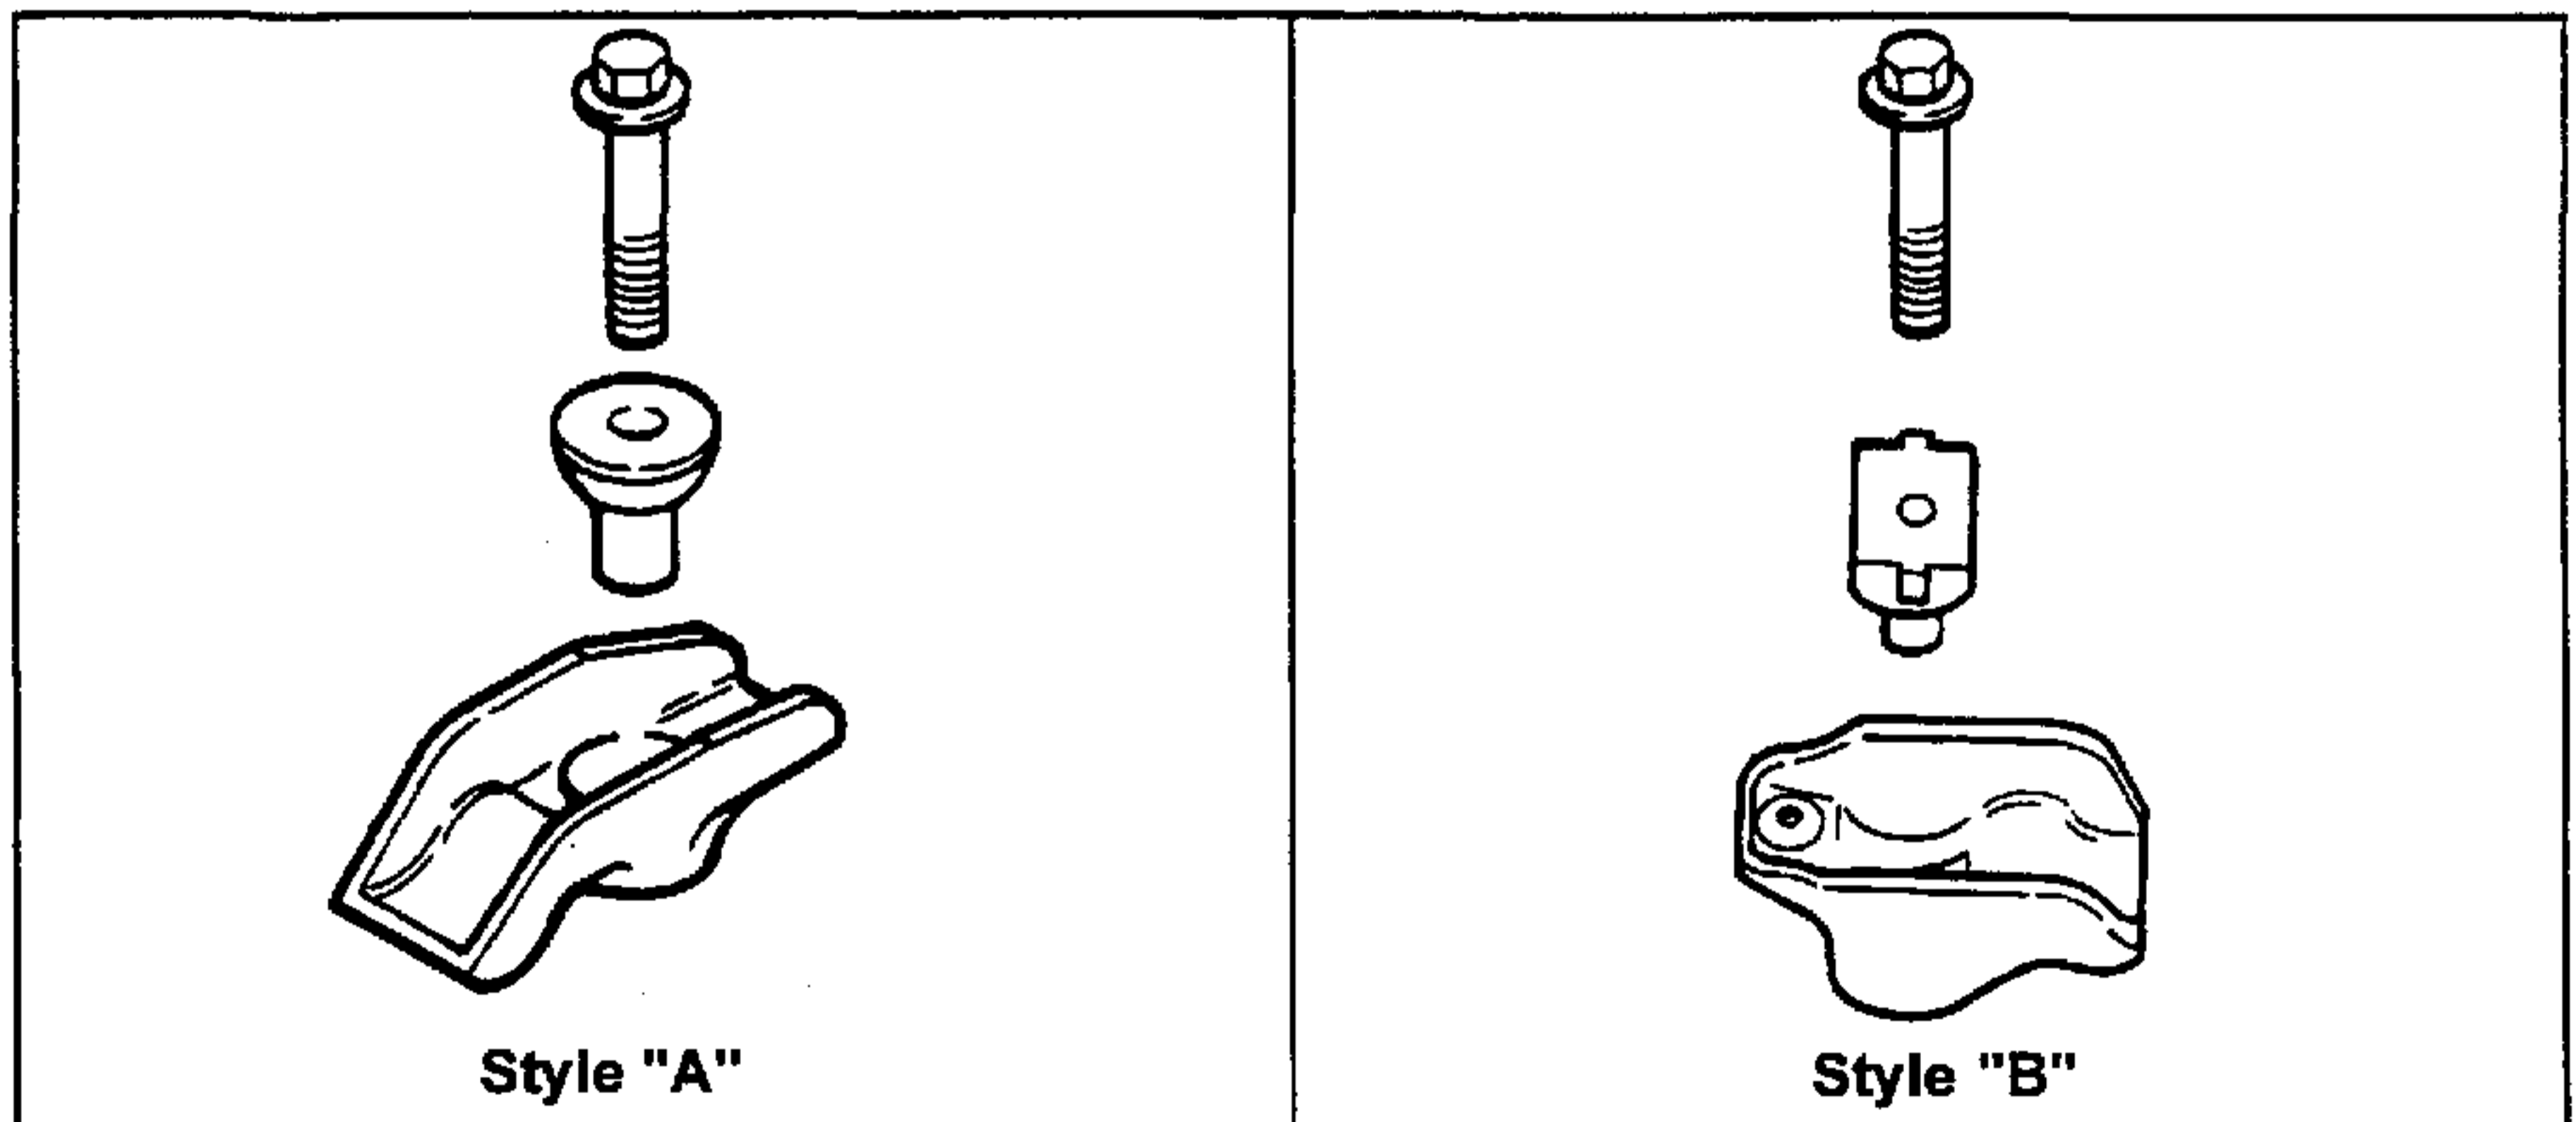


Figure 1.

Warranty Allowance: This is a product improvement, therefore updating of engines does not qualify under warranty.

Service Manager	Parts Manager	Service Tech.	Service Tech.	Service Tech.

Circulate and Initial