



Model: 190-300-100 46 inch High Vac Deck manufactured after August 1997

Date: December 11, 1997


Subject: MOWER DECK

Product improvements have been implemented on the 46 inch mower deck for the Series 2000 tractors. Changes were made to improve belt life and reduce the likelihood of the belts jumping off the pulley.

In the idler arm for the spindle drive belt, the shoulder spacer (p/n 711-3272) was changed. A new shoulder spacer (p/n 711-3272A) will provide freer motion of the arm on the mower deck. Refer to the illustration below.

In order to increase tension on the PTO belt, the extension spring (p/n 732-3115) was changed. If the deck is properly adjusted, the new extension spring (p/n 732-0861) will maintain proper belt tension. Refer to the illustration below.

NOTE. Existing stock of 711-3272 and 732-3115 will remain for other applications.

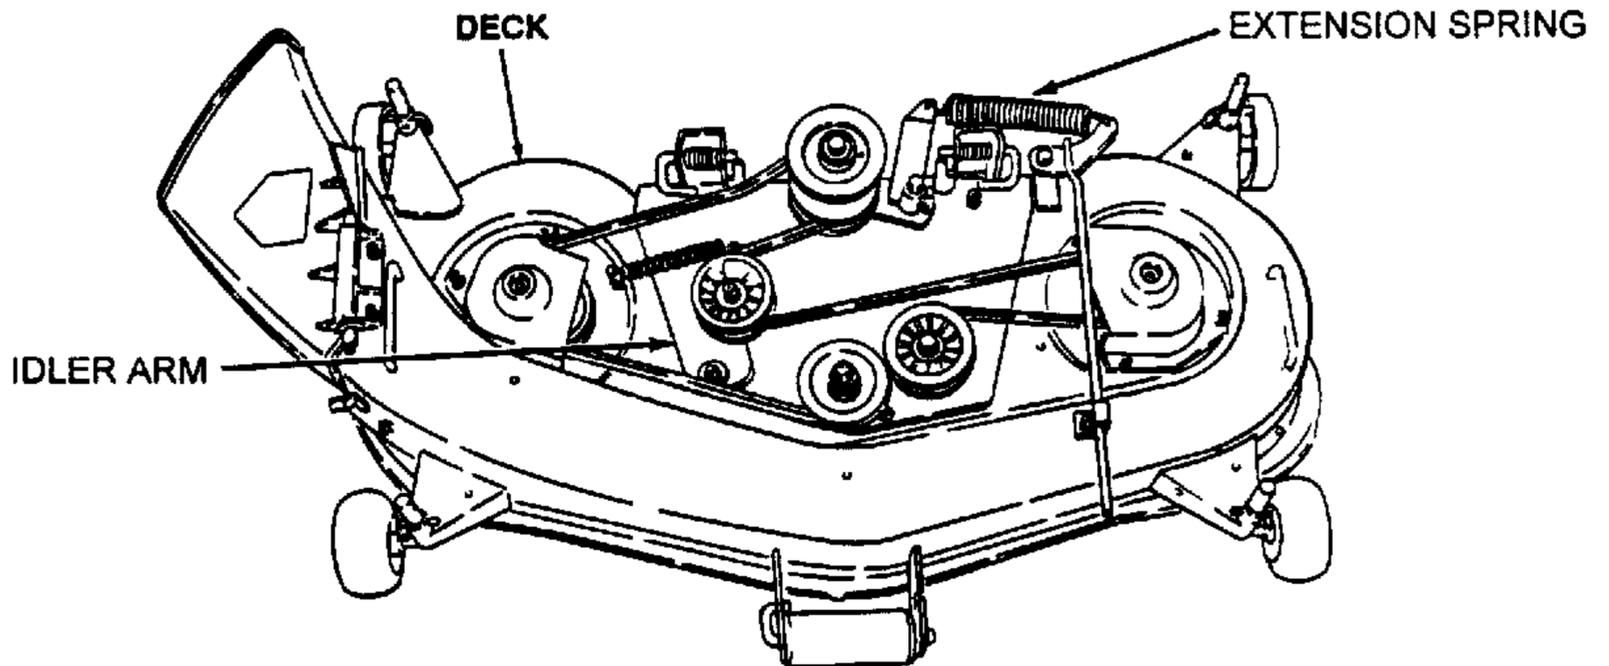

Warranty Allowance. This is a product improvement. If warranty consideration is required on 46 inch decks built before August 1997, please call the Cub Cadet Service Department for special authorization

Service Manager	Parts Manager	Service Tech	Service Tech	Service Tech

Circulate and Initial